



TO: ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES AND SERVICE CENTERS
ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES REPRESENTATIVES

MODEL AFFECTED: MCM-H11 (UNITS MANUFACTURED AFTER NOVEMBER 1980
WITH GROUP CALL DECODER)

SYMPTOM: LOW FREQUENCY AUDIO DISTORTION

CURE:

As prescribed in SSC Service Bulletin 82-260

Change:

1. R81 from 4.7K to 2K (4704-0202-031)
2. R94 from 1K to 2.7K (4704-0272-031)
3. C105 from .0022mfd to .0033mfd mylar (1508-0332-610)

Add:

1. 150K resistor from the base of Q10 to the negative side of C106 (4704-0154-031).

Verify:

In recently received units, verify the connections of the added 150K resistor.

TECHNICAL SERVICE DEPARTMENT
REGENCY COMMUNICATIONS, INC.

